


PHOTOGRAPHS:



No. 1 - The camera was facing approximately south. View of the side of the Reactor, which was facing north, while at the premises of Cratex Industrial Packing Ltd. in Coquitlam (near Vancouver), BC.

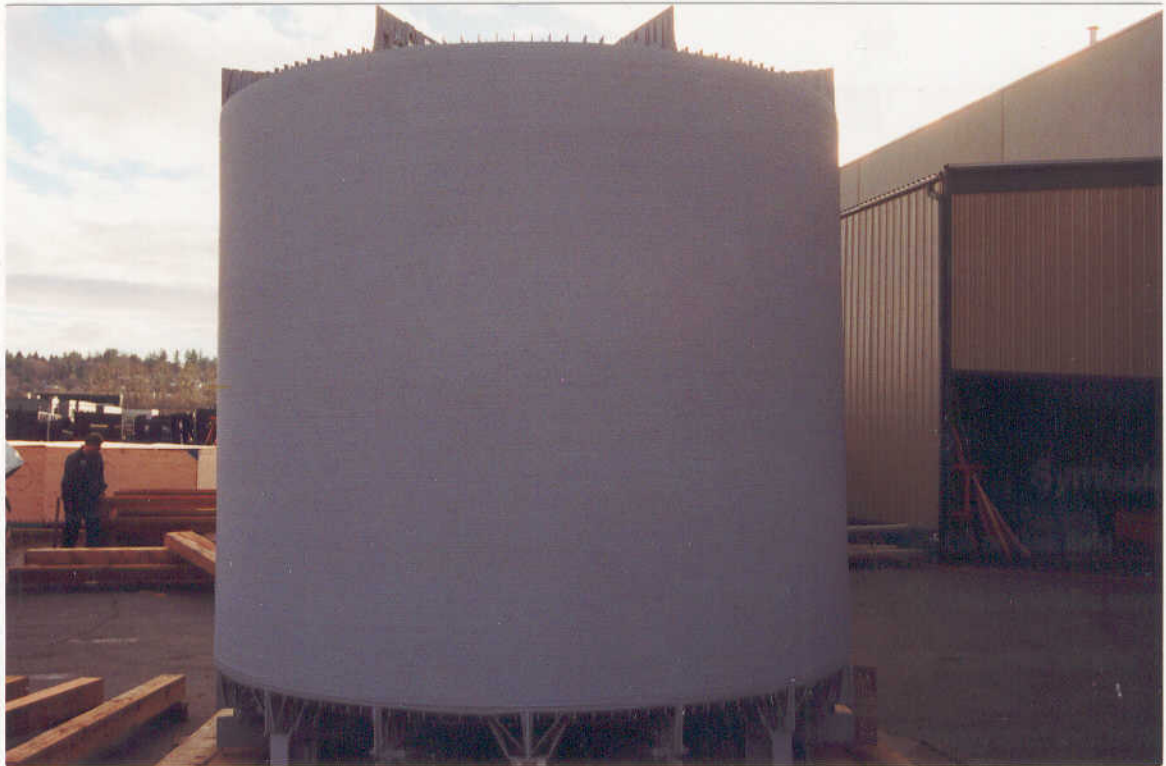

No. 2 - The same as above, but the camera was facing approximately west. This side of the Reactor was facing east.



No. 3 - Close-up showing the repaired scratch on the side of the Reactor which was facing east. This scratch can be seen in one of the Photographs of Mr. Roger Robinson, CMS, before it was repaired (APPENDIX "A").



No. 4 - Minor unrepaired scratch found on the side which was facing east, above the above described repaired scratch.



No. 5 - Another view of the Reactor while the Camera was facing approximately northwest. This was the side of the Reactor which was facing southeast.



No. 6 - Another view of the Reactor while the Camera was facing approximately north. This was the side of the Reactor which was facing south.